

364E-0.0 364E-0.1 364E-1.1 364E-1.2 364E-2.1 364E-2.2 364E-3.1 364E-3.2 366E-0.0
366E-0.1 366E-2.1 366E-2.2 366E-3.1 366E-3.2 366E-4.1 366E-4.2 367E-0.0 367E-0.1
367E-2.1 367E-2.2 367E-3.1 367E-3.2 367E-4.1 367E-4.2 385E-0.0 385E-0.1 385E-2.1
385E-2.2 385E-3.1 385E-3.2 385E-4.1 385E-4.2 386E-0.0 386E-0.1 386E-2.1 386E-2.2
386E-3.1 386E-3.2 386E-4.1 386E-4.2 390E-0.0



Spannstifte zum Ausdrehen




Bild 2



Spannbolzen zum Ausdrehen



Bild 3

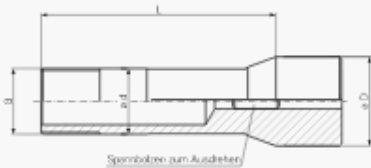

Spannbolzen zum Ausdrehen

Bild 4

364 E - 3.1	3	25	34	92,5	75	25	§ 24,7 x 1/15"
364 E - 3.2	3	25	34	92,5	75	50	§ 24,7 x 1/15"
366 E - 0.0	2	28	36	102			Tr 27 x 1/20"
366 E - 0.1	4	28	36	102		25	Tr 27 x 1/20"
366 E - 2.1	3	28	36	102	50	25	Tr 27 x 1/20"
366 E - 2.2	3	28	36	102	50	50	Tr 27 x 1/20"
366 E - 3.1	3	28	36	102	75	25	Tr 27 x 1/20"
366 E - 3.2	3	28	36	102	75	50	Tr 27 x 1/20"
366 E - 4.1	3	28	36	102	100	25	Tr 27 x 1/20"
366 E - 4.2	3	28	36	102	100	50	Tr 27 x 1/20"
367 E - 0.0	2	28	38	100			Tr 28x 1,5
367 E - 0.1	4	28	38	100		25	Tr 28x 1,5
367 E - 2.1	3	28	38	100	50	25	Tr 28x 1,5
367 E - 2.2	3	28	38	100	50	50	Tr 28x 1,5
367 E - 3.1	3	28	38	100	75	25	Tr 28x 1,5
367 E - 3.2	3	28	38	100	75	50	Tr 28x 1,5
367 E - 4.1	3	28	38	100	100	25	Tr 28x 1,5
367 E - 4.2	3	28	38	100	100	50	Tr 28x 1,5
385 E - 0.0	2	31,75	37,3	83			31,45 x 1/20"
385 E - 0.1	4	31,75	37,3	83		25	31,45 x 1/20"
385 E - 2.1	3	31,75	37,3	83	50	25	31,45 x 1/20"
385 E - 2.2	3	31,75	37,3	83	50	50	31,45 x 1/20"
385 E - 3.1	3	31,75	37,3	83	75	25	31,45 x 1/20"
385 E - 3.2	3	31,75	37,3	83	75	50	31,45x 1/20"
385 E - 4.1	3	31,75	37,3	83	100	25	31,45x 1/20"
385 E - 4.2	3	31,75	37,3	83	100	50	31,45x 1/20"
386 E - 0.0	2	32	45	110			Tr 32 x 1,5
386 E - 0.1	4	32	45	110		25	Tr 32 x 1,5
386 E - 2.1	3	32	45	110	50	25	Tr 32 x 1,5
386 E - 2.2	3	32	45	110	50	50	Tr 32 x 1,5
386 E - 3.1	3	32	45	110	75	25	Tr 32 x 1,5
386 E - 3.2	3	32	45	110	75	50	Tr 32 x 1,5
386 E - 4.1	3	32	45	110	100	25	Tr 32 x 1,5
386 E - 4.2	3	32	45	110	100	50	Tr 32 x 1,5
390 E - 0.0	2	47	60	110	60		Tr 47 x 1,5